

Brushless DC Motor Driver

Instruction for JKBLD4810A V2.1



Main features

- ◆ It can be connected with an external speed display board, showing the speed; it can also be connected with computers to set drive parameters
- ◆ It has double speed closed current design with low speed torque and smooth operation;
- ◆ It has high speed output with the maximum speed of 20000rpm / min;
- ◆ Speed control mode : analog quantity 0-5V, (according to the users' requirement we can set PWM within 10Hz-300Hz
- ◆ It has have EN, DIR signal control side;
- ◆ It can output tachometer pulse;
- ◆ It has over-current, overvoltage, under voltage , overheating, motor stalling and other protection functions;

Product Overview

JKBLD4810A brushless DC motor driver is our company's latest high-tech product for the field of medium power motor drive. This product uses a large-scale integrated circuit to replace the original hardware. It has higher anti-jamming and fast response ability. It is suitable for all the three-phase brushless DC motors with low voltage DC18V-50V(boards show DC24V-48V) and peak current below 10A. Even if working with large current, it is still in low temperature. It is widely used in knitting equipment, medical equipment, food packaging machinery, power tools and a series of areas of electrical automation and control.

Functional Overview

Function as following: (default setting mode: Square wave, Hall, Open loop)

- 1.Run model: square wave, with hall sensor, open loop speed
- 2.Run model: square wave, with hall sensor, closed loop speed
- 3.Run model: square wave, without hall sensor, open loop speed
- 4.Run model: square wave, without hall sensor, closed loop speed
- 5.Run model: constant-torque device, open loop speed (Don't run for long time with overloading)
- 6.Run model: constant-torque device, closed loop speed (Don't run for long time with overloading)

On the basis of our upper computer software and hand debugger, all the above functions can be set by yourself

Note: It can not control the direction without Hall Sensor

Electrical Specification:

(1) Environmental Temperature: 25℃

Power supply		DC18V~50V direct current (Capacity according to motor power selection)
The maximum input current		Not greater than 10A (according to motor and rated load)
The maximum power		The maximum is 480W (over power motor is strictly prohibited)
Insulation resistance		General temperature > 500MΩ
Insulation strength		General temperature and pressure 0.5KV, 1 minute
Cooling method		Natural air cooling (forced air cooling is recommended)
Environment	Condition	Avoid dust, oil mist and corrosive gases
	Temperature	0℃~+50℃
	Humidity	< 80%RH, no condensation, no frost
	Vibration	< 0.5G (4.9m/s ²) 10Hz-60Hz (non-continuous operation)
Reserved temperature		-20℃~+65℃

(2) Environmental Parameter

Brushless DC Motor Driver JKBLD4810A

Size	118mmX75.5mmX34mm
Weight	About 0.3Kg

Note: Due to dramatic changes in the temperature of the storage environment, it is easy to form condensation or frost. In this case, the drive should be placed for 12 hours or more. Until the drive temperature and ambient temperature is consistent, it can be on power.

Terminal interface description



Function	Mark	Description
Indicator light	POWER	If the green power indicator is lightened, it shows that power is normal.
	ALM	If the red status indicator is slow flash, it means waiting; Quick flash means operation; It always lights meaning faults or off-line;
RS232 communication port	TTL	It can be connected with an external speed display board to display speed. It can also access the computer to set the drive parameters. Details are shown in debugging software instructions
Control signal port	+5V1	Control signal power+(inner power output)
	VSP	External speed control signal Control way: (1)By connecting with a potentiometer to change VSP, then it can complete 0 ~ 100% speed adjustment. The range is 0-5V; (2)speed control by PWM: positive terminals connect with VSP, and negative terminals connect with GND1, inputting frequency by VSP to change duty cycle, and speed changed, the range is 10-300Hz
	FG	Motor speed pulse output is measuring the frequency of this signal. Then converts it into the actual motor speed.
	DIR	Rotary direction is controlled by high and low electrical level, motor forward: connected with GND1, motor reversal (anticlockwise) ;without GND1 or connected with +5V, motor forward (clockwise)
	EN	Connected EN with GND1, motor can work(online status);without connected or high electrical lever, motor can not work(offline status and the red light keep working)
	GND1	Control signal's power supply
Hall control port	+5V2	+ motor's Hall power
	HU	Hall sensor signal U phase input
	HV	Hall sensor signal V phase input
	HW	Hall sensor signal W phase input
	GND2	The motor's Hall power supply
The motor and power	U、V、W	The motor's three-phase output signal
	GND、V+	GND、V+ stand for direct current flow. The input power is DC18V~50V.(boards show DC24V-48V)

Function and method

Speed mode (VSP/PWM)	<p>1. The external input speed: two external terminals of the external potentiometer(5K-10K) respectively connected to the driver's GND1 and +5 V1 terminal. If the regulator is connected to the VSP end, you can use an external potentiometer to adjust speed. It can also be made by the other control unit's (such as PLC, microcontroller, etc.) input analog voltage to VSP side (relative to GND1). VSP port accepts the range of DC 0V ~ +5 V and the corresponding motor speed is 0 ~ rated speed;</p> <p>2. PWM speed: the PWM's positive end is connected to the VSP. The negative end connects with GND1. The frequency is 10Hz-300KHz, changing the duty cycle speed.</p>
Speed signal output (FG)	<p>The drive provides the motor speed pulse signal, which is positive proportion to the motor speed, pulse output way: RPUP 4.7k, open collector output</p> <p>1. the motor speed (RPM) = $F \div N \times 60$</p> <p>F = actually measured frequency current on the FG foot by frequency table</p> <p>N = Pole logarithm , 2 pole motor, $N = 2$; 4 pole motor, $N = 4$</p> <p>For example: the user selects a 4 pole motor. When the output FG signal is 200Hz, the motor speed = $200 \div 4 \times 60 = 3000 \text{ r / min.}$</p>
The motor positive and negative signal (DIR)	<p>By controlling high low-level of DIR to control the motor's positive and reverse turn.</p> <p>Noticed: Swerved suddenly when motor is at high speed, to avoid the damage of motor and equipment , when DIR get the transform single , we must make motor stop running for 2s, then change the motor direction ,improve speed to the set value.</p>
Start/Stop signal (EN)	<p>By controlling high low-level of EN to control the motor's stop and run. When EN is low level, motor run; when EN is high level or non-connect ,motor stop working, red light keep working.</p> <p>Power consumption is less than or equal to 20MA.</p> <p>Fault Value : short circuit with EN and GND.</p>

Connection Diagram

Product Size (units : mm)

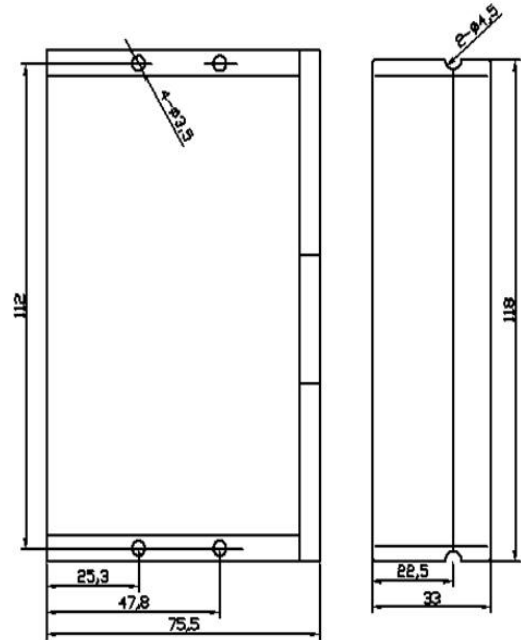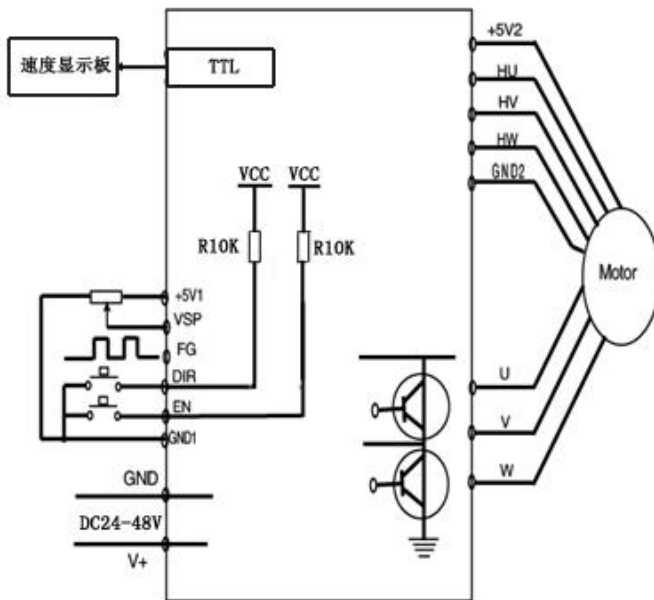

To get the best heat dissipation, please adopt side mounting

Safety attention

- ★ The motor and drive wiring must be connected in the power-off state. Do not connect electrical wiring under power.
- ★ According to the illustrated method, connect the power cord, motor winding wire and Hall signal line correctly. Please pay attention to the order of UVW three-phase must be consistent.
- ★ Do not disassemble the drive at random to prevent damage.
- ★ Do not touch all terminals on power-on state.
- ★ Do not drive without shell operation
- ★ Impact of the drive may cause damage.

General problems

1. How can get it started as soon as possible when you first use the drive?

After you correctly connect the power cord, the motor line, the Hall line, the external potentiometer slowly accelerates. After the motor is turned correctly, you can test the enable, direction and other functions. If you are unfamiliar with the product, the initial use should be done after the test. And then it can be installed to the actual use.

2. What will come about if power supply is reverse?

It will immediately burn the drive.

3. What is the maximum of the upper control signal voltage ?

The maximum voltage of the speed regulation signal is 5V. Exceeding this voltage will cause the drive to burn.

4. After the driver has been working for a long time, the shell is hot. Is it normal?

Yes, it is. At room temperature, after long working hours, it is up to 90 degrees. And it will not affect the performance.

5. The power indicator is light, but the motor does not turn and shift, what is the reason?

There may be a mistake in the phase line and the Hall line. Please re-energize the wiring according to the motor manual.

6. Can my motor speed transferred to 6000 with this drive?

The maximum speed of the brushless motor is determined by the parameters of the motor itself. The drive can control the motor speed from 0 to the highest speed.

7. I already have a motor and how to install this drive after wiring?

You must first determine the motor phase and the definition of the Hall line, and then you can connect it with wires. If you are not sure, you need to ask the motor manufacturers. Incorrect wiring can cause damage to the drive.

8. Can I add some features on this drive or do new product development?

Yes, please contact us.